



KITPLANES FOR AFRICA

www.saplanes.co.za

P.O.Box 326

KOMATIPOORT

1340

South Africa

Rick Burrough 082 4100032

Stefan Coetzee 082 6018970

info@saplanes.co.za

SERVICE BULLETIN

AIRCRAFT EFFECTED: Bushbaby

BULLETIN NUMBER: SB005

ORIGINAL ISSUE DATE: 04-04-02

REVISION DATE: 14-11-08

SUBJECT: Lower Lift strut attachment bolt length.

APPLICABILITY: All

COMPLIANCE: Mandatory.

PROBLEM: An Inspected Bushbaby was found to have the incorrect bolts installed at the lower lift strut-fuselage point.

SOLUTION: These bolts must be checked before the next flight.
The correct bolts supplied by KFA will have the shank long enough to not have any thread in the shear area of the joint.
Do not turn the nut up to the shank when setting it.
If it is necessary, up to 3 washers can be used to allow the nut to be correctly set.
Contact the factory if the correct bolts are required.