

**KITPLANES FOR AFRICA**

**www.saplanes.co.za**

**P.O.Box 326**

**KOMATIPOORT**

**1340**

**South Africa**

**Rick Burrough 082 4100032**

**Stefan Coetzee 082 6018970**

**info@saplanes.co.za**

**SERVICE BULLETIN**

**AIRCRAFT EFFECTED:** All models

**BULLETIN NUMBER:** SB011

**ORIGINAL ISSUE DATE:** 01-12-00


**REVISION DATE:** 17-11-08

**SUBJECT:** Control column torque tube cracks

**APPLICABILITY:** All KFA aircraft

**COMPLIANCE:** Mandatory

**Problem:** Cracks have been found on two occasions on the FCC control column torque tube, left rear side.

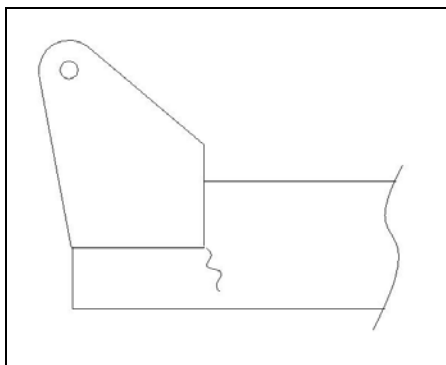

**Solution:** Remove the blue bearing block and inspect torque tube for cracks at every 100 hour or annual inspection.  
If any cracks are found, send the part back to KFA for replacement or repair.